

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

BUILDING NO. 8200	STREET, CITY, STATE, ZIP Jantzen Rd #201, Modesto CA 95357	Date of Inspection 7/20/2026	No. of Pages 6
-----------------------------	--	--	--------------------------



BEST

PEST

MANAGEMENT

P.O. Box 1348
Riverbank, CA 95367
Tel: (209) 497-5777
Website: www.bestpest209.com
Email: info@bestpest209.com

Firm Registration No. PR 8106	Report No. 20626	Escrow No.
Ordered By: Green Valley Homes 4713 Greenleaf Court Ste B 95356, CA 95356 Attn: Andrew Quintong	Property Owner/Party of Interest	Report Sent To: Green Valley Homes 4713 Greenleaf Court Ste B 95356, CA 95356 Attn: Andrew Quintong


COMPLETE REPORT ☒
LIMITED REPORT ☐
SUPPLEMENTAL REPORT ☐
REINSPECTION REPORT ☐

General Description: MOBILE HOME	Inspection Tag Posted: UNDER KITCHEN SINK
	Other Tags Posted: NONE

An inspection has been made to the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites ☒
Drywood Termites ☐
Fungus/Dryrot ☒
Other Findings ☒
Further Inspection ☒

If any of above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

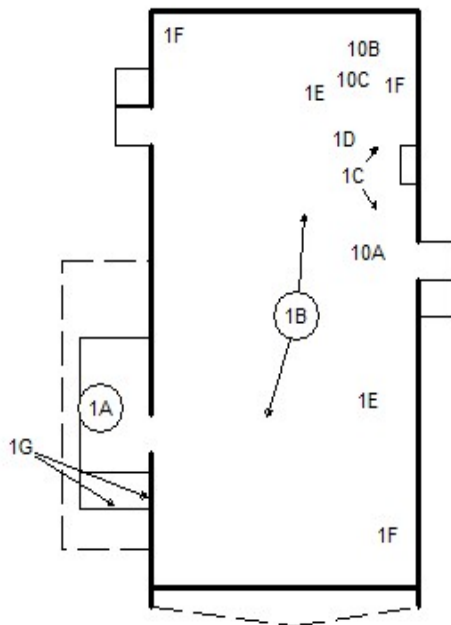

Inspected by David Christensen

State License No. FR57754

Signature



You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceeding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California 95815.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control board at (916) 561-8708, or (800) 737-8188 or www.pestboard.ca.gov.

8200

Jantzen Rd #201, Modesto CA 95357

7/20/2026

20626

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION 1/SECTION 2 CONDITIONS EVIDENT ON THE DATE OF INSPECTION.

SECTION 1 CONTAINS ITEMS WHERE THERE IS VISIBLE EVIDENCE OF ACTIVE WOOD DESTROYING PESTS OR ORGANISMS OR CONDITIONS THAT HAVE RESULTED IN OR FROM WOOD DESTROYING PEST OR ORGANISMS.

SECTION 2 ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO WOOD DESTROYING PESTS OR ORGANISMS, BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE COMPLETE INSPECTION, DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE THE INSPECTION AND CANNOT BE DEFINED AS SECTION 1 OR SECTION 2.

NOTE WATER STAINS WERE NOTED ON THE SHEETROCK/WALL COVERING AT THE UTILITY HOOK UP IN THE LAUNDRY ROOM. NO VISIBLE SIGNS OF INFECTION OR INFESTATION AT THIS TIME. WE FIND NO REASON TO OPEN THIS AREA AT THIS TIME. NO RECOMMENDATIONS ARE MADE.

Substructure Areas:

- ITEM 1A Cellulose debris (wood, paper products) with evidence of subterranean termites was noted in the subarea.
- RECOMMENDATION Remove the cellulose debris of a rakable size.
***** This is a Section 1 Item *****
- ITEM 1B Subterranean termites were noted tubing up the piers/foundation in the subarea.
- RECOMMENDATION Scrape down the termite tubes. Treat entire sub structure for control of subterranean termites. This may include treating the substructure area, or any other area that we find necessary to prevent subterranean termites from gaining entry into the structure.
***** This is a Section 1 Item *****
- ITEM 1C Fungus and or Subterranean Termite has damaged the support pier blocking/pad as viewed in the subarea.
- RECOMMENDATION Remove the fungus damaged wood members. If no further damaged is exposed, replace with new material.
***** This is a Section 1 Item *****
- ITEM 1D Fungus has damaged the sub floor beneath the hall bathroom adjacent to the toilet as viewed from the subarea.
- RECOMMENDATION Remove the toilet, floor covering and particle board. If no further damage is exposed, replace the damaged wood members with new material. Install new particle board and floor covering. Reset the toilet on a new wax ring.
***** This is a Section 1 Item *****

8200

Jantzen Rd #201, Modesto CA 95357

7/20/2026

20626

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

Substructure Areas:

ITEM 1E Corrosion and or evidence of leakage was noted at the plumbing as viewed in the subarea.

RECOMMENDATION The owner is to employ a licensed plumber to inspect and repair the plumbing as found to be necessary.

***** This is a Section 1 Item *****

ITEM 1F There is earth to wood contact at the skirt framing and or pier pads as viewed in the subarea.

RECOMMENDATION The client/owner is to hire proper trades to redistribute the soil to break the earth to wood contact.

NOTE Any additional findings will be issued on a supplemental report.

***** This is a Section 1 Item *****

ITEM 1G Fungus has damaged the staircase wood members as viewed in the subarea. (stringer/blocking)

RECOMMENDATION Remove the fungus damaged wood members. If no further damaged is exposed, replace with new material.

***** This is a Section 1 Item *****

Other - Interiors:

ITEM 10A Disconnected/uncapped pipe with standing water was noted at the plumbing in the laundry room.

RECOMMENDATION The owner is to employ a licensed plumber to inspect and repair the plumbing as found to be necessary.

***** This is a Section 2 Item *****

ITEM 10B The toilet was found to be loose in the master bath.

RECOMMENDATION Remove the toilet . If no damage is exposed, reset the toilet on a new wax ring.

***** This is a Section 2 Item *****

ITEM 10C A leak was noted at the glass enclosure of the stall shower in the master bath.

RECOMMENDATION The owner is to employ a glass company to inspect and repair the glass enclosure as found to be necessary.

***** This is a Section 2 Item *****

8200

Jantzen Rd #201, Modesto CA 95357

7/20/2026

20626

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

THE EXTERIOR SURFACE OF THE ROOF WILL NOT BE INSPECTED. IF YOU WANT THE WATER TIGHTNESS OF THE ROOF DETERMINED, YOU SHOULD CONTACT A ROOFING CONTRACTOR WHO IS LICENSED BY THE CONTRACTORS STATE LICENSING BOARD.

NOTICE: The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept BEST PEST MANAGEMENT bid or you may contract directly with another registered company licensed to perform the work. If you choose to contract directly with another registered company, BEST PEST MANAGEMENT. will not in any way be responsible for any act or omission in the performance of work that you directly contract with another to perform.

"NOTICE: REPORTS ON THIS STRUCTURE PREPARED BY VARIOUS REGISTERED COMPANIES SHOULD LIST THE SAME FINDINGS (i.e. TERMITE INFESTATIONS, TERMITE DAMAGE, FUNGUS DAMAGE etc.) HOWEVER, RECOMMENDATIONS TO CORRECT THESE FINDINGS MAY VARY FROM COMPANY TO COMPANY. YOU HAVE A RIGHT TO SEEK A SECOND OPINION FROM ANOTHER COMPANY"

This company will reinspect repairs done by others within four months of the original inspection. A charge, in any, can be no greater than the original inspection fee for each reinspection report. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs. This company does not guarantee work performed by other.

IN THE EVENT LOCALIZED TREATMENT IS RECOMMENDED IN THIS REPORT: Local treatment is not intended to be an entire structure treatment method. If infestations of wood destroying pests extend or exist beyond the area(s) of local treatment, they may not be exterminated.

ASBESTOS - **IMPORTANT NOTE FOR ALL PARTIES REGARDING THIS PROPERTY**

Notice to customer and buyers having repairs done - Some residential structures are constructed with material that may contain material manufactured with asbestos. Our company is not qualified or certified to identify these materials. If the owner or interested parties are aware of, interested in, or concerned about this condition, they should contact the appropriate agencies that are qualified or certified in this field.

8200

Jantzen Rd #201, Modesto CA 95357

7/20/2026

20626

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

Prices quoted are for this company to complete all items in this report. If all items are not requested to be completed by this company the bids are subject to change. Our bid for linoleum and tile are for a standard grade FHA material. Any upgrade in material which may be desired by owner will have additional charges. This companies minimum charge to perform work at any property is \$475.00

During the process of treatment or replacement it may be necessary to drill holes through ceramic tiles or other floor coverings; These holes will then be sealed with concrete. We will exercise due care but assume no responsibility for cracks, chipping or other damage to floor coverings. We do not re-lay carpeting pulled back for treatment or repairs.

We assume no responsibility for damage to any Plumbing, Gas, or Electric lines, etc., that may become damaged in the process of pressure treatment of concrete slabs or replacement of concrete or structural wood members.

Work performed by our company will be guaranteed for a period of one year from date of completion. Fumigations for the control of drywood termites will be guaranteed for a period of three years. Plumbing and maintenance repairs are guaranteed for 30 days.

ALL REPAIRS COMPLETED BY OTHERS MUST BE REINSPECTED BY BEST PEST MANAGEMENT BEFORE A CERTIFICATION WILL BE ISSUED. THE RE INSPECTION WILL ONLY CERTIFY THE ABSENTS OR INFESTATION OR INFECTION IN THE ACCESSIBLE AND VISIBLE AREAS. WE DO NOT GUARANTEE WORK COMPLETED BY OTHERS, NOR DOES THIS FIRM MAKE ANY STATEMENTS CONCERNING WORKMANSHIP OF THOSE REPAIRS. WORKMANSHIP IS ONLY DETERMINABLE BY THOSE PAYING FOR OR RECEIVING THOSE SERVICES. A RE INSPECTION OF SPECIFIC ITEMS ON THE REPORT OR OF ANY OTHER CONDITION PERTAINING TO THIS STRUCTURE CAN BE DONE AT AN ADDITIONAL COST PER REQUEST. THIS RE INSPECTION MUST BE DONE WITHIN 4 MONTHS OF THE ORIGINAL.

This property was not inspected for the presence or absence of health related molds or fungi. By California law, we are neither qualified, authorized, nor licensed to inspect for health related molds or fungi.

The Structural Pest Control board Mold Policy Statement is as follows:

"Molds, sometimes called mildew, are not wood-destroying organisms. Branch 3 licensees do not have a duty under the Structural Pest Control Act and related regulations to classify molds as harmful to human health or not harmful to human health. This does not modify the Structural Pest Control Act or related regulations."

STATE LAW REQUIRES THAT YOU BE GIVEN THE FOLLOWING INFORMATION CAUTION PESTICIDES ARE TOXIC CHEMICALS. STRUCTURAL PEST CONTROL OPERATORS ARE LICENSED AND REGULATED BY THE STRUCTURAL PEST CONTROL BOARD, AND APPLY PESTICIDES WHICH ARE REGISTERED AND APPROVED FOR USE BY CALIFORNIA DEPARTMENT OF FOOD AND AGRICULTURE AND THE UNITED STATES ENVIRONMENTAL PROTECTION AGENCY. REGISTRATION IS GRANTED WHEN THE STATE FINDS THAT BASED ON EXISTING SCIENTIFIC EVIDENCE THERE ARE NO APPRECIABLE RISKS IF PROPER USE CONDITIONS ARE FOLLOWED OR THAT THE RISKS ARE OUTWEIGHED BY THE BENEFITS. THE DEGREE OF RISK DEPENDS UPON THE DEGREE OF EXPOSURE, SO EXPOSURE SHOULD BE MINIMIZED.

8200

Jantzen Rd #201, Modesto CA 95357

7/20/2026

20626

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

IF WITHIN 24 HOURS FOLLOWING APPLICATION YOU EXPERIENCE SYMPTOMS SIMILAR TO COMMON SEASONAL ILLNESS COMPARABLE TO THE FLU, CONTACT YOUR PHYSICIAN OR POISON CONTROL CENTER AND YOUR PEST CONTROL OPERATOR IMMEDIATELY.

FOR FURTHER INFORMATION CONTACT ANY OR THE FOLLOWING:

BEST PEST MANAGEMENT - (209) 497-5777

POISON CONTROL CENTER - (800) 876-4766

COUNTY HEALTH DEPARTMENT

SAN JOAQUIN COUNTY HEALTH OFFICE - (209) 468-3411

STANISLAUS COUNTY HEALTH OFFICE - (209) 558-8804

MERCED COUNTY HEALTH OFFICE - (209) 381-1100

COUNTY AGRICULTURE COMMISSIONER

SAN JOAQUIN COUNTY - (209) 468-3300

STANISLAUS COUNTY - (209) 525-4730

MERCED COUNTY - (209) 385-7411

STRUCTURAL PEST CONTROL BOARD - (800) 737-8188

One or more of the following chemicals may be applied to your property: AggresZor 75 (Imidacloprid) Premise 75 Insecticide (Imidacloprid) - Tim-Bor (Disodium Octaborate Tetrahydrate) Termidor (Fipronil) - Vikane (Sulfuryl Fluoride) - I-MaxxPro (Imidacloprid) Termidor HE (Fipronil) Termidor SC (Fipronil) Premise Foam (Imidacloprid) Termidor Dry Dust (Fipronil)

NOTE: Choropicrin is used as a "Warning Agent" on all structural fumigations.